

# Installation guidance

## Gyproc® Cove Adhesive

TIMES ARE APPROXIMATE

### 0 mins



Mix the required amount of adhesive with clean water to the required consistency. The mixture should be of a creamy consistency free from lumps. Approx 1kg of Gyproc Cove Adhesive to 4 linear metres of Gyproc Cove or Cornice

### 5 mins



Leave to rest for 10 minutes before re-stirring

### 5 - 40 mins



Apply sufficient Gyproc Cove Adhesive to Gyproc Cove or Cornice to ensure good overall contact with the background. Press firmly into place and support with nails. Remove any excess adhesive and clean Gyproc Cove or Cornice with clean water and a brush/sponge

Leave until set

### 120 mins



The Gyproc Cove Adhesive will set hard to a white finish in 2 hours

It is advisable to leave for a further 24 hours for any moisture to fully dry prior to surface priming or painting

#### Note:

Working time is approx 40 mins.

Ensure all surfaces are sound and free from grease, flaking paint and dust.

Painted and decorated surfaces should be scratched to form a key.

Remove all wallpaper, leaving an overlap of 2-3mm with the Gyproc Cove or Cornice for best finish.

Also suitable for filling of mitred joints.

**Times and processes are given as guidance. On site practice may vary.**



Finishing times are **reduced** by suction



Finishing times are **extended** by cold weather conditions